



# Method for Damage Detection of CFRP Plates Using Lamb Waves and Digital Signal Processing Techniques <sup>†</sup>

Paulo Monson <sup>1,\*</sup> , Pedro Oliveira Conceição Junior <sup>2</sup>, Alessandro Roger Rodrigues <sup>3</sup> , Paulo Aguiar <sup>1</sup> and Cristiano Soares Junior <sup>1</sup>

<sup>1</sup> Department of Electrical Engineering, Sao Paulo State University (UNESP), Bauru 17033-360, Sao Paulo, Brazil

<sup>2</sup> Department of Electrical and Computer Engineering, Sao Carlos School of Engineering (EESC), University of Sao Paulo (USP), Sao Carlos 13566-590, Sao Paulo, Brazil

<sup>3</sup> Department of Mechanical Engineering, Sao Carlos School of Engineering (EESC), University of Sao Paulo (USP), Sao Carlos 13566-590, Sao Paulo, Brazil

\* Correspondence: paulo.monson@unesp.br

<sup>†</sup> Presented at the 9th International Electronic Conference on Sensors and Applications, 1–15 November 2022; Available online: <https://ecsa-9.sciforum.net/>.

**Abstract:** The identification and severity of structural damages in carbon fiber reinforced polymer (CFRP), especially in the early stage, is critical in structural health monitoring (SHM) of composite materials. Among several approaches used to accomplish this goal, ultrasound inspection using Lamb waves has been taking place within non-destructive testing (NDT) methods. Likewise, the use of digital signal processing techniques for structural damage diagnosis has become popular due to the fact that it provides relevant information through feature extraction. In this context, this paper presents an alternative strategy based on the use of root mean square deviation (RMSD) and correlation coefficient deviation metric (CCDM) representative indices to extract the most sensitive information related to damage in CFRP plates through ultrasonic NDT signals in specific frequency ranges. In the experimental analysis, CFRP coupons were subjected to two types of damages: cracking and delamination. The signals, generated by piezoelectric transducers attached to the host structure using the pitch-catch method of Lamb waves, were subject to signal processing parameters based on the proposed approach. The results reveal that the proposed method was able to characterize the different types of damage in CFRP, as well as their severity in specific frequency bands. The results indicate the feasibility of the proposed method to detect and characterize damage in composite materials in a simple way, which is attractive for industrial applications.

**Keywords:** CFRP; SHM; damage detection; signal processing; Lamb waves; piezoelectric transducers



**Citation:** Monson, P.; Junior, P.O.C.; Rodrigues, A.R.; Aguiar, P.; Junior, C.S. Method for Damage Detection of CFRP Plates Using Lamb Waves and Digital Signal Processing Techniques. *Eng. Proc.* **2022**, *27*, 42. <https://doi.org/10.3390/ecsa-9-13357>

Academic Editor: Stefano Mariani

Published: 1 November 2022

**Publisher's Note:** MDPI stays neutral with regard to jurisdictional claims in published maps and institutional affiliations.



**Copyright:** © 2022 by the authors. Licensee MDPI, Basel, Switzerland. This article is an open access article distributed under the terms and conditions of the Creative Commons Attribution (CC BY) license (<https://creativecommons.org/licenses/by/4.0/>).

## 1. Introduction

The adoption of composite materials, such as carbon fiber reinforced polymer (CFRP), has been increasing in the last decades, being extensively employed in structural components in several areas, due to its physical and mechanical characteristics, such as high strength, stiffness, weight, and corrosion resistance [1–3]. It must be emphasized that CFRP recently has been gradually replacing traditional metallic alloys in the development of the aeronautical industry, providing performance improvements, thanks to the weight reduction that, in some cases, can reach up to 50% of the total weight of the aircraft [4,5]. However, the use of CFRP presents some challenges when applying it in engineering projects, due to the anisotropic nature of composite materials and the incidence of well-known damages, such as fissures and delamination. Fissures, usually a precursor to delamination, occur in the matrix and are perpendicular to the fiber direction, causing an inter-layer stress concentration. The development of this damage causes delamination through the concentration of stress between the layers, which reduces their resistance and, in some cases, can lead to total failure of the structure [3]. The increased use of CFRP motivates the development of

novel methods for monitoring these structures' integrity to detect the damage progression, providing actions to mitigate the possible identified failures and thus ensuring the required safety levels for this material usage [6]. In this scope, the structural health monitoring (SHM) of this material is presented as a viable solution to address this problem. SHM is the subject of several research studies, and there is a wide range of tools and techniques to evaluate the material's condition during its life cycle. Non-destructive testing (NDT) is a method that interrogates the structure with transducers at various stages of its life cycle, causing no damage to the structure during its use and able to provide information about possible failures to the monitored equipment. One technique in this kind of test is to use guided waves to emit a signal that travels through the structure under analysis; this signal is received by a sensor and used to extract the characteristics that can provide information about its current condition [7,8]. Currently, there is a wide range of sensors that can be used in SHM applications, particularly piezoelectric transducers, which are widely used because of their low cost and easy implementation; these sensors can also be used as actuators due to the piezoelectric effect [7,8]. Similarly, several signal processing techniques and data-driven approaches using machine learning have been reported for damage detection in CFRP, where condition indicators based on the change in power spectral density, energy, and time of flight [9], as well as Gaussian discriminant analysis [10] and a damage index based on fissure density in the polymer matrix [1] have been used to characterize and classify sample damage.

In this work, an alternative approach for damage detection in CFRP structures is proposed, based on piezoelectric transducers and the Lamb wave method in association with digital signal processing techniques. The method was evaluated through application in experimental CFRP structures in order to detect two types of failures, cracking and delamination, in comparison to the baseline. The main contribution of the present study is the application of RMSD and CCDM metrics to evaluate the damage incidence from a specific frequency band and for different types of composite failures, which have not been reported in the literature related to this dataset yet. This work aims to advance knowledge regarding damage detection methods in composite materials and to present a simple and low-cost solution for industrial applications.


## 2. Materials and Methods

The dataset used in this study was obtained from an experimental fatigue test on CFRP composites, conducted by the Stanford Structures and Composites Laboratory (SACL) in cooperation with the Prognostic Center of Excellence (PCoE) at the NASA Ames Research Center [9]. This public dataset has been used by many authors (e.g., [1,3,10–13]).

The composite samples were prepared using a  $254 \times 152.4$  mm Torayca T700G unidirectional prepreg composite. The samples have a dogbone geometry and a  $19.3 \times 5.08$  mm notch, as illustrated in Figure 1, to provide stress concentration.

For monitoring the fatigue test damage, two sets were used, with six SMART Layer<sup>®</sup> piezoelectric zirconate titanate (PZT) transducers each, developed by Acellent Technologies Inc. (Sunnyvale, CA, USA), arranged in a pitch-catch configuration. This configuration allows monitoring the Lamb wave propagation in 36 different trajectories.

The samples prepared with sensors and actuators were subjected to cyclic loading. At the test beginning, the transducer signals are collected in order to determine the initial condition of the structure. At the end of a sequence of cycles, the structure is evaluated again, the signals are collected, and the sample is submitted to an X-ray examination to verify the occurrence of damage. Then, a count of the visual cracks is done, and the values are inserted into an electronic spreadsheet that follows the data set. Information about delamination behavior is also reported.

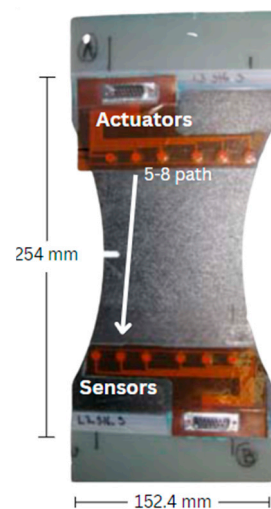

**Figure 1.** CFRP coupon prepared for fatigue testing. Adapted from [3].

For this study, data from the sample labeled by the experiment authors as L1S11, belonging to Layup 1 with the layer configuration  $[0_2/90_4]_S$ , were used.

### *Proposed Methodology*


In this study, we performed an analysis of the data set described before, in order to evaluate the behavior of the signals acquired from the piezoelectric transducers as the CFRP sample degrades. For this, we used a trajectory of 5–8, chosen for the presence of delamination as the CFRP coupon is subjected to the fatigue process, and a trajectory of 3–10 to evaluate microcracking. This analysis was performed in the time domain, evaluating the amplitude and displacement patterns of the signal according to the structural damage. The frequency spectrum analysis of the signals was performed using the fast Fourier transform (FFT), calculated with a Hanning windowing, to identify the most sensitive frequency bands to the damage. Widely used damage indices in SHM, such as the root mean square deviation (RMSD) and correlation coefficient deviation metric (CCDM), were also applied, following the approach published by [14] and comparing the initial condition signal with the observed damage signals in the X-ray examination of the sample.

## **3. Results and Discussion**

As mentioned previously, the selected trajectories were 5–8 and 3–10. The analyses of each selected trajectory were performed using the signals collected between 100 and 60 thousand cycles of the experimental test. This range comprises the most significant damage progression suffered by the sample. The results of the time and frequency domain analyses, as well as the damage indices, are presented below.

### *3.1. Time-Domain Analysis*


Initially, a time domain analysis was performed for the signal acquired by the transducer illustrated in Figure 2, in which it is possible to observe the behavior patterns for the different classes of damage present in the sample. Figure 2a shows the signal pattern with delamination in the structure, where it is possible to observe a reduction in signal amplitude compared to the baseline condition, and also the displacement of the signal peaks, caused by the damage progression in the sample. The signals from trajectory 3–10, shown in Figure 2b, where the only damage is due to the micro-cracking, have a more regular comportment, with the signal amplitude attenuation and displacement to the opposite direction presented in the trajectory with delamination.

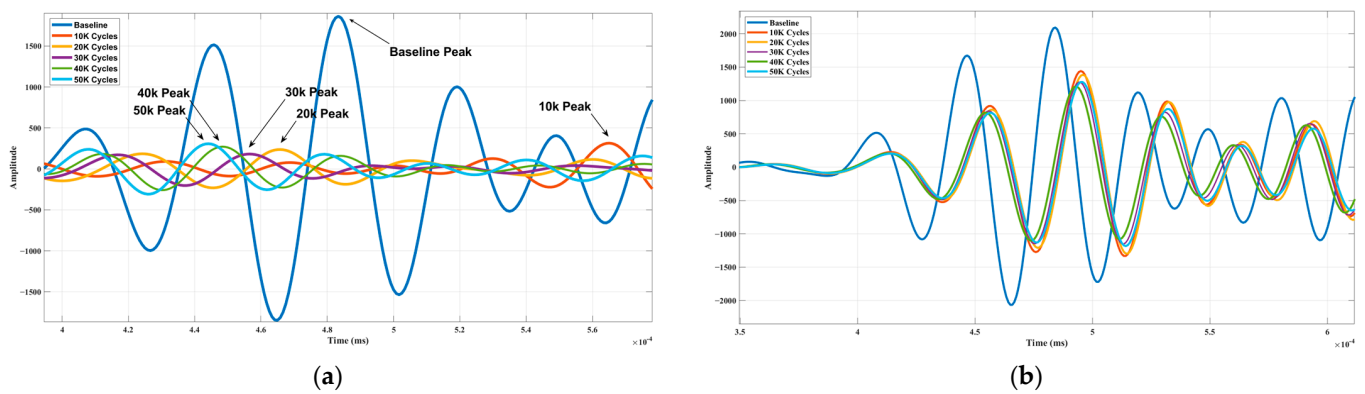

**Figure 2.** Time-domain signals for the (a) 5–10 and (b) 3–8 path.

### 3.2. Frequency-Domain Analysis


By using the Fast Fourier Transform (FFT), the frequency spectrum was analyzed. Figure 3 shows the spectral behavior of the trajectory with delamination (Figure 3a), where a significant reduction in the magnitude as the delamination progresses is evident, as well as the main bands where the damage happens. As observed previously, path 3–10 (Figure 3b) presents a magnitude reduction characteristic, but not as pronounced as the one caused by delamination, as the fissures occur in its matrix. With this analysis, in the next step, damage metrics will be calculated to identify the frequency bands most susceptible to damage.

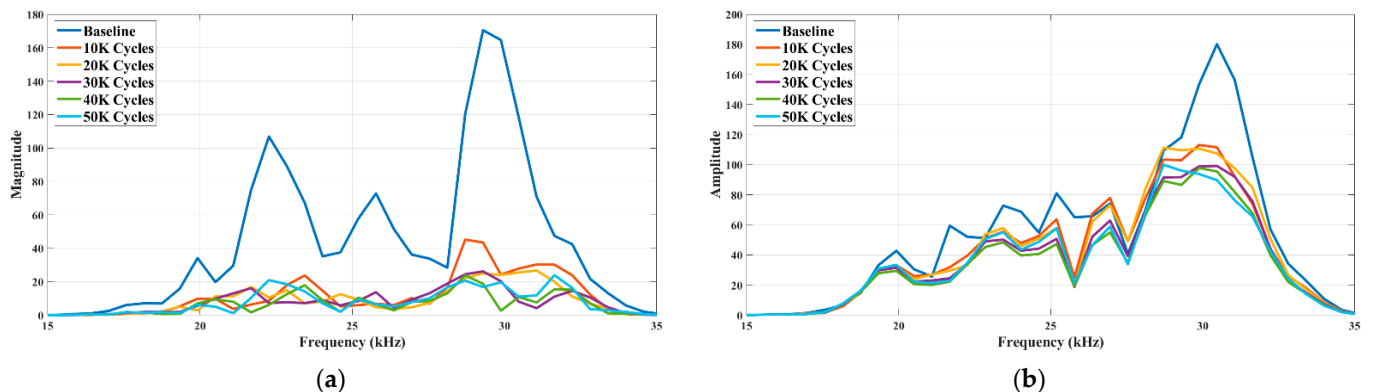

**Figure 3.** Frequency-domain signal for the (a) 5–10 and (b) 3–8 path.


### 3.3. Damage Indices

To contribute to the analysis of the damage present in this data set, the RMSD and CCDM indexes were calculated for the two damage classifications. These indices allow a comparison of the signals obtained with samples in pristine conditions (baseline), with the signals that may present some kind of damage. For both types of damage were adopted a 16 to 34 kHz band, with a 2 kHz range, using the FFT magnitude values. Figure 4 shows the RMSD (Figure 4a) and CCDM (Figure 4b) calculated with the delamination signal. The results indicate that frequency bands from 20 to 22 kHz (RMSD) and 28 to 30 kHz (CCDM) are more sensitive for the characterization of the delamination severity suffered by the coupon.

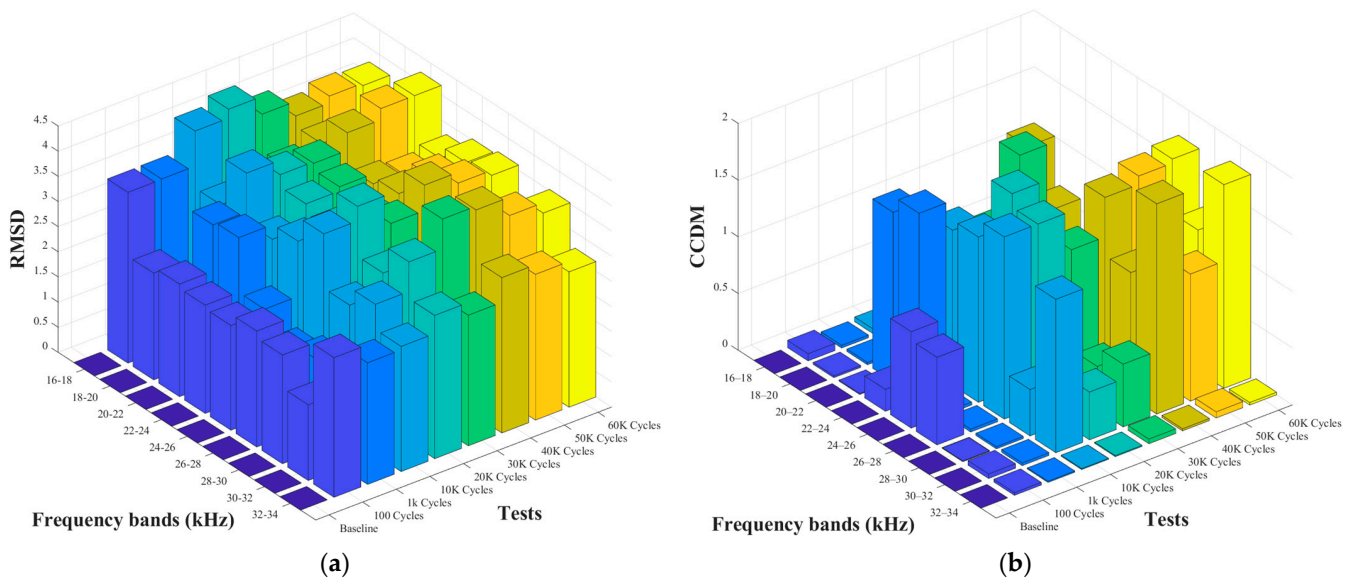

**Figure 4.** Damage indexes: (a) RMSD and (b) CCDM index for the 5–8 path with delamination.

Using the same parameters, the indices were calculated for the trajectory with fissures. Figure 5 presents the RMSD (Figure 5a) and CCDM (Figure 5b) indices calculated for the delamination signal. This analysis evidences the capacity of these metrics in detecting the fissure progression in several stages of the sample's lifetime, particularly in the bands from 30 to 32 kHz for the RMSD metric and 24 to 26 kHz for the CCDM metric, which is a useful solution when applied in industrial engineering projects. The solution is also notable for its simplicity and low computational cost since the most representative frequency bands for damage are below 40 kHz.

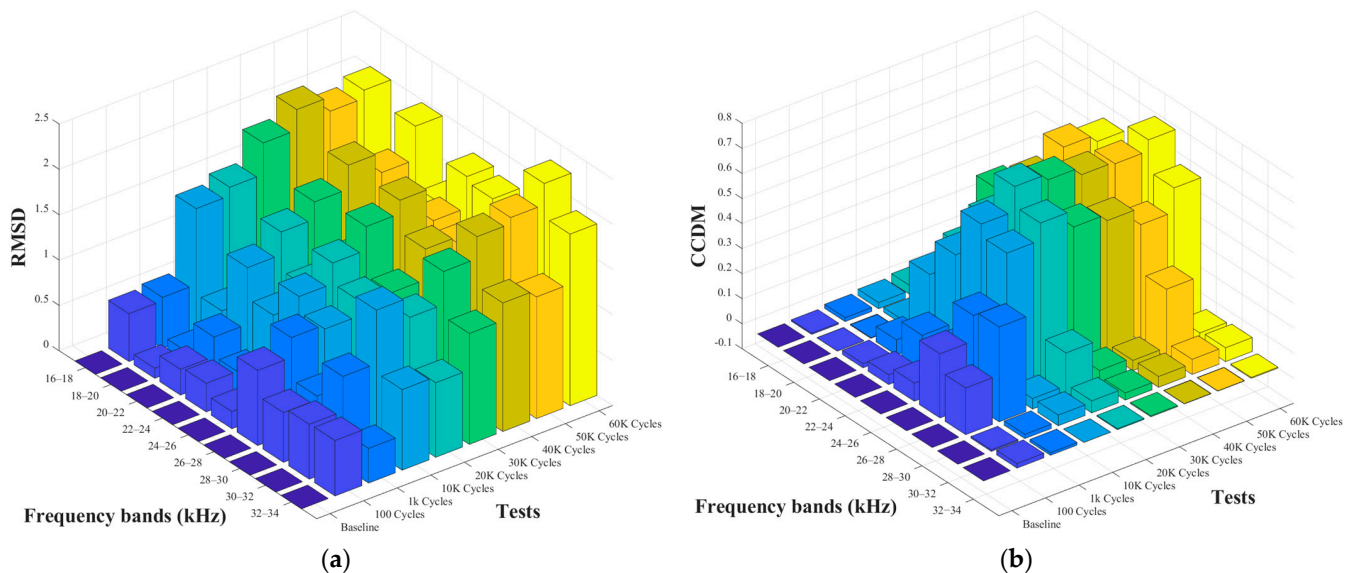

**Figure 5.** Damage indexes: (a) RMSD and (b) CCDM index for the 3–10 path with microcracks.

#### 4. Conclusions

In this work, a study was conducted regarding the use of signal processing techniques to develop a methodology for classifying the damage levels in CFRP structures using the Lamb wave method. The signals presented in the dataset were subjected to analysis in the time and frequency domain, also applying the damage metrics used in SHM applications to provide the characteristics of the damage in these samples.



The analysis demonstrated that is possible, through the applied tools, to extract characteristics able to correlate the signal obtained by the sensors with the damages observed in the structure as well as their severity, as evidenced by the application of the RMSD and CCDM metrics. The proposed methodology was shown to be viable for industrial applications, characterized by using low-cost transducers and reduced computational processing, allowing the implementation of the method in low-end hardware.

**Author Contributions:** Conceptualization, P.M. and P.O.C.J.; methodology, P.O.C.J.; software, P.M. and P.O.C.J.; validation A.R.R., P.O.C.J., P.A. and C.S.J.; formal analysis, P.M. and P.O.C.J.; investigation, P.O.C.J. and A.R.R.; writing—original draft preparation, P.M. and P.O.C.J.; writing—review and editing, P.O.C.J., A.R.R. and C.S.J.; supervision, P.O.C.J. and A.R.R.; project administration, P.O.C.J. All authors have read and agreed to the published version of the manuscript.

**Funding:** This study was financed in part by the Coordenação de Aperfeiçoamento de Pessoal de Nível Superior—Brasil (CAPES)—Finance Code 001.

**Institutional Review Board Statement:** Not applicable.

**Data Availability Statement:** Not applicable.

**Conflicts of Interest:** The authors declare no conflict of interest.

## References

1. Wilson, C.L.; Chang, F.K. Monitoring fatigue-induced transverse matrix cracks in laminated composites using built-in acousto-ultrasonic techniques. *Struct. Health Monit.* **2016**, *15*, 335–350. [CrossRef]
2. Callister, W.D., Jr.; Rethwisch, D.G. *Materials Science and Engineering: An Introduction*; Wiley: New York, NY, USA, 2020.
3. Larrosa, C.C.; Lonkar, K.; Shankar, S.; Chang, F.-K. Damage Classification in Composite Laminates: Matrix Micro-Cracking and Delamination. Available online: <http://dpi-proceedings.com/index.php/shm2011/article/view/22247> (accessed on 7 July 2022).
4. Teti, R.; Segreto, T.; Caggiano, A.; Nele, L. Smart multi-sensor monitoring in drilling of CFRP/CFRP composite material stacks for aerospace assembly applications. *Appl. Sci.* **2020**, *10*, 758. [CrossRef]
5. Hanser, S.; Ferrer, G.; Dupouy, S. Keeping in shape A350 structure repairs and kits. Available online: <https://aircraft.airbus.com/sites/g/files/jlcbta126/files/2021-11/FAST-article-Keeping-in-shape-November-2021.pdf> (accessed on 7 July 2022).
6. Tavares, S.M.O.; de Castro, P.M.S.T. An overview of fatigue in aircraft structures. *Fatigue Fract. Eng. Mater. Struct.* **2017**, *40*, 1510–1529. [CrossRef]
7. Rocha, H.; Semprinoschnig, C.; Nunes, J.P. Sensors for process and structural health monitoring of aerospace composites: A review. *Eng. Struct.* **2021**, *237*, 112231. [CrossRef]
8. Güemes, A.; Fernandez-Lopez, A.; Pozo, A.R.; Sierra-Pérez, J. Structural health monitoring for advanced composite structures: A review. *J. Compos. Sci.* **2020**, *4*, 13. [CrossRef]
9. Saxena, A.; Goebel, K.; Larrosa, C.C.; Janapati, V.; Roy, S.; Chang, F.K. Accelerated aging experiments for prognostics of damage growth in composite materials. In Proceedings of the 8th International Workshop on Structural Health Monitoring, Stanford, CA, USA, 13–15 September 2013; Volume 1, pp. 1283–1291.
10. Larrosa, C.; Lonkar, K.; Chang, F.K. In situ damage classification for composite laminates using Gaussian discriminant analysis. *Struct. Health Monit.* **2014**, *13*, 190–204. [CrossRef]
11. Chiachío, J.; Chiachío, M.; Saxena, A.; Rus, G.; Goebel, K. An energy-based prognostic framework to predict fatigue damage evolution in composites. In Proceedings of the Annual Conference of the Prognostics and Health Management Society, New Orleans, LA, USA, 14–17 October 2013; pp. 363–371.
12. Corbetta, M.; Sbarufatti, C.; Giglio, M.; Saxena, A.; Goebel, K. A Bayesian framework for fatigue life prediction of composite laminates under co-existing matrix cracks and delamination. *Compos. Struct.* **2018**, *187*, 58–70. [CrossRef]
13. Corbetta, M.; Saxena, A.; Giglio, M.; Goebel, K. Evaluation of multiple damage-mode models for prognostics of carbon fiber-reinforced polymers. In Proceedings of the 10th International Workshop on Structural Health Monitoring—IWSHM 2015, Stanford, CA, USA, 1–3 September 2015; Volume 2, pp. 609–616. [CrossRef]
14. Junior, P.; D’addona, D.M.; Aguiar, P.R.; Teti, R. Dressing tool condition monitoring through impedance-based sensors: Part 1—PZT diaphragm transducer response and emi sensing technique. *Sensors* **2018**, *18*, 4455. [CrossRef] [PubMed]